


149-3 COMPONENT TESTING: MULTIFUNCTION SWITCH

2001 F53

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self-Powered Test Lamp or Ohmmeter to Terminals	Move Switch to These Positions	A Good Switch Will Indicate
Washer Switch Circuit	590 and 993	With Wiper Switch OFF: Push Washer Switch In Release Washer Switch	Closed Circuit 103.3K ohm
Wiper Switch Circuit	589 and 993	OFF INT LOW HIGH	47.6K ohm + 5% 11.33K ohm + 5% 4.08K ohm + 5% Closed Circuit
Interval Time Adjust	590 and 993	INT and OFF LOW and HIGH	Rotate Control toward OFF: Ohmmeter will show smoothly increasing resistance from 3.3K ohm min. to 103.3K ohm max. + 10% 3.3K ohm + 10%

SCHEMATIC - WIPER/WASHER PORTION

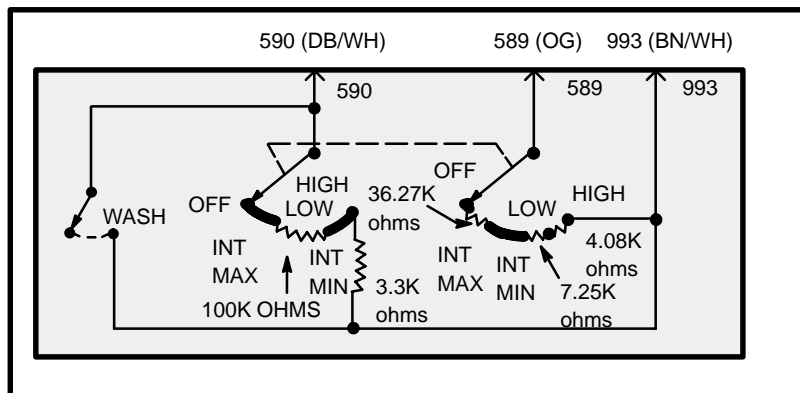

TERMINALS

